




C175 Remove Fuel Valve Power Module

Service Letter PS46140

Fuel Valve can fail and shut down the engine

Permanent Corrective Action:

 Remove power module, change wiring to power fuel valve directly from ECM power supply

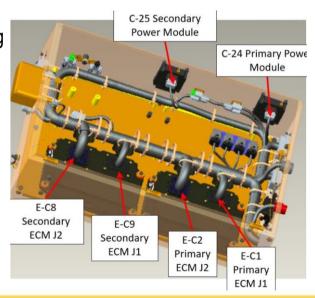



C175 High Pressure Fuel Pump

Issue:

Some bottom end failures seen with less than 10K hrs.

Root Cause:

- Quality Control at Supplier (Already Addressed)
- Materials not robust enough for typical oil contamination and oil lubricity
- Roller and pin fatigue failure

Interim Corrective Action:

Multiple Improvements in Quality Control Implemented

Permanent Corrective Action:

Change roller and pin materials

Current Status:

Field testing with limited population underway



3500 ASO Valve Failures

Permanent Corrective Action:

- New Proximity Sensors <u>Engine News Published (M0095301-00)</u>
- Strong arm brackets and light weight gate

Timeline for Strong arm brackets and ASO Valve:

- Harvested 11 pairs of field follow hardware
- New design validated
- Parts in procurement
- Publish Engine News / Available at dealers (3Q 2019)



Questions?

LESWXXXX ©2017 Caterpillar All rights reserved.

Cat®, CATERPILLAR, their respective logos, "Caterpillar Yellow" and the "Power Edge" trade dress, as well as corporate and product identity used herein, are trademarks of Caterpillar and may not be used without permission.

